

Issued in Renton, Washington on October 15, 2001.

Ali Bahrami,

*Acting Manager, Transport Airplane
Directorate, Aircraft Certification Service.*

[FR Doc. 01-26472 Filed 10-19-01; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2001-NM-305-AD; Amendment 39-12477; AD 2001-21-06]

RIN 2120-AA64

Airworthiness Directives; Gulfstream Model G-V Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule; request for comments.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that is applicable to certain Gulfstream Model G-V series airplanes. This action requires an initial inspection of the electrical connections for the fire extinguisher bottles; an inspection after any subsequent maintenance affecting the fire extinguisher bottles; corrective action, if necessary; and reporting of the results of the inspection to the Federal Aviation Administration (FAA). This action is prompted by a report indicating that the electrical connections for the fire extinguisher bottle squibs had been improperly installed either during manufacturing or during subsequent maintenance. This action is necessary to prevent fire extinguishing agent from being discharged into the wrong location, which could result in failure to extinguish an in-flight fire on an affected engine and jeopardize operation of the opposite engine. This action is intended to address the identified unsafe condition.

DATES: Effective November 6, 2001.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of November 6, 2001.

Comments for inclusion in the Rules Docket must be received on or before December 21, 2001.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-305-AD, 1601 Lind Avenue, SW.,

Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-iarcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-305-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in this AD may be obtained from Gulfstream Aerospace Corporation, P.O. Box 2206, M/S D-10, Savannah, Georgia 31402-9980. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Robert Chupka, Aerospace Engineer, Systems and Flight Test Branch, ACE-116A, FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia 30349; telephone (770) 703-6046; fax (770) 703-6097.

SUPPLEMENTARY INFORMATION: The FAA has received a report that, during an inspection of a Gulfstream Model G-V series airplane, the electrical connections for the left and right fire extinguisher bottle squibs were found to be improperly installed. The improper installation occurred either during manufacturing or during subsequent maintenance affecting the fire extinguisher bottles. This condition, if not corrected, could cause fire extinguishing agent to be discharged into the wrong location, which could result in failure to extinguish an in-flight fire on an affected engine and jeopardize operation of the opposite engine.

Explanation of Relevant Service Information

The FAA has reviewed and approved Gulfstream V Alert Customer Bulletin No. 14, dated September 20, 2001, which describes procedures for a one-time inspection of the electrical connections for the engine fire extinguisher bottles and for correction of any incorrect electrical connection which is detected.

Explanation of the Requirements of the Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design, this AD is being issued to prevent fire extinguishing agent from being discharged into the wrong location, which could result in failure to extinguish an in-flight fire on an affected engine and jeopardize operation of the opposite engine. This AD requires accomplishment of the actions specified in the service bulletin described previously, except as discussed below. This AD also requires that operators report results of inspection findings to the FAA.

Differences Between Service Bulletin and This AD

Because it is not known whether the improper installation of the electrical connections for the fire extinguisher bottles occurred during the manufacturing process or during subsequent maintenance, this AD requires inspection of those electrical connections following any maintenance affecting the fire extinguisher bottles. The alert customer bulletin does not refer to inspection following maintenance. This AD also requires that inspection findings be reported to the FAA, whereas the alert customer bulletin recommends notice to Gulfstream that the Accomplishment Instructions of the alert customer bulletin have been performed.

Interim Action

This is considered to be interim action until final action is identified, at which time the FAA may consider further rulemaking.

Determination of Rule's Effective Date

Since a situation exists that requires the immediate adoption of this regulation, it is found that notice and opportunity for prior public comment hereon are impracticable, and that good cause exists for making this amendment effective in less than 30 days.

Comments Invited

Although this action is in the form of a final rule that involves requirements affecting flight safety and, thus, was not preceded by notice and an opportunity for public comment, comments are invited on this rule. Interested persons are invited to comment on this rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified under the caption **ADDRESSES**. All

communications received on or before the closing date for comments will be considered, and this rule may be amended in light of the comments received. Factual information that supports the commenter's ideas and suggestions is extremely helpful in evaluating the effectiveness of the AD action and determining whether additional rulemaking action would be needed.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify the rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report that summarizes each FAA-public contact concerned with the substance of this AD will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this rule must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-305-AD." The postcard will be date stamped and returned to the commenter.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

The FAA has determined that this regulation is an emergency regulation that must be issued immediately to correct an unsafe condition in aircraft, and that it is not a "significant regulatory action" under Executive Order 12866. It has been determined further that this action involves an emergency regulation under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979). If it is determined that this emergency regulation otherwise would be significant under DOT Regulatory

Policies and Procedures, a final regulatory evaluation will be prepared and placed in the Rules Docket. A copy of it, if filed, may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2001-21-06 Gulfstream Aerospace

Corporation: Amendment 39-12477. Docket 2001-NM-305-AD.

Applicability: Model G-V series airplanes, serial numbers 501 through 652 inclusive; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent fire extinguishing agent from being discharged into the wrong location, which could result in failure to extinguish an in-flight fire on an affected engine and jeopardize operation of the opposite engine, accomplish the following:

Inspections

- (a) Within the next 25 flight hours, but no later than 10 days after the effective date of this AD: Perform a general visual inspection of the electrical connections of the fire extinguisher bottles for correct connections, in accordance with Gulfstream Alert Customer Bulletin No. 14, dated September 20, 2001.

- (b) Prior to further flight following any maintenance that affects the fire extinguisher bottles: Perform the inspection required by paragraph (a) of this AD.

Note 2: For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or drop-light, and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

Corrective Action

- (c) If any incorrect electrical connection is detected during the inspections required by paragraph (a) or (b) of this AD: Correct that connection, in accordance with the Accomplishment Instructions of Gulfstream Alert Customer Bulletin No. 14, dated September 20, 2001.

Reporting

- (d) Submit a report of inspection findings (both positive and negative) to the Manager, Atlanta Aircraft Certification Office (ACO), FAA, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia 30349; fax (770) 703-6097; at the applicable time specified in paragraph (d)(1) or (d)(2) of this AD. The report must include the inspection results, a description of any discrepancies found, the airplane serial number, and the number of landings and flight hours on the airplane. Information collection requirements contained in this regulation have been approved by the Office of Management and Budget (OMB) under the provisions of the Paperwork Reduction Act of 1980 (44 U.S.C. 3501 *et seq.*) and have been assigned OMB Control Number 2120-0056.

- (1) For airplanes on which the inspection required by paragraph (a) of this AD is accomplished after the effective date of this AD: Submit the report within 35 days after performing the inspection required by paragraph (a) of this AD.

- (2) For airplanes on which the inspection required by paragraph (a) of this AD has been accomplished prior to the effective date of this AD: Submit the report within 35 days after the effective date of this AD.

Alternative Methods of Compliance

- (e) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Atlanta ACO. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Atlanta ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Atlanta ACO.

Special Flight Permits

- (f) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR

21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(g) The actions shall be done in accordance with Gulfstream V Alert Customer Bulletin No. 14, dated September 20, 2001. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Gulfstream Aerospace Corporation, P.O. Box 2206, M/S D-10, Savannah, Georgia 31402-9980. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Effective Date

(h) This amendment becomes effective on November 6, 2001.

Issued in Renton, Washington, on October 15, 2001.

Ali Bahrami,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 01-26473 Filed 10-19-01; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF VETERANS AFFAIRS

38 CFR Parts 19 and 20

RIN 2900-AJ97

Board of Veterans' Appeals: Appeals Regulations and Rules of Practice—Jurisdiction

AGENCY: Department of Veterans Affairs.

ACTION: Final rule.

SUMMARY: This document adopts as a final rule proposed amendments to the Appeals Regulations and Rules of Practice of the Board of Veterans' Appeals (Board). These amendments clarify that the Board may address questions related to its jurisdiction in the first instance. They also provide for notice and an opportunity to comment when the Board raises jurisdictional questions on its own initiative.

DATES: *Effective Date:* November 21, 2001.

FOR FURTHER INFORMATION CONTACT:

Steven L. Keller, Senior Deputy Vice Chairman, Board of Veterans' Appeals, Department of Veterans Affairs, 810 Vermont Avenue, NW., Washington, DC 20420, (202) 565-5978.

SUPPLEMENTARY INFORMATION: Initial decisions on claims for veterans' benefits are made at VA field offices

throughout the nation. Claimants may appeal those decisions to the Board. This final rule amends Department of Veterans Affairs' regulations pertaining to such appeals.

These amendments were previously published in the **Federal Register** as a proposed rule on April 4, 2001, at 66 FR 17840. We received no comments. Based on the rationale set forth in the proposed rule, we are adopting its provisions as a final rule, with a nonsubstantive editorial change to the first sentence of § 20.101(e).

Paperwork Reduction Act

This document contains no provisions constituting a collection of information under the Paperwork Reduction Act (44 U.S.C. 3501-3520).

Unfunded Mandates

The Unfunded Mandates Reform Act requires (in section 202) that agencies prepare an assessment of anticipated costs and benefits before developing any rule that may result in an expenditure by State, local, or tribal governments, in the aggregate, or by the private sector of \$100 million or more in any given year. This rule would have no consequential effect on State, local, or tribal governments.

Regulatory Flexibility Act

The Secretary hereby certifies that this final rule does not have a significant economic impact on a substantial number of small entities as they are defined in the Regulatory Flexibility Act, 5 U.S.C. 601-612. This rule would affect only the processing of claims by VA and would not affect small businesses.

Therefore, pursuant to 5 U.S.C. 605(b), this final rule is exempt from the initial and final regulatory flexibility analyses requirements of sections 603 and 604.

There is no Catalog of Federal Domestic Assistance number for this final rule.

List of Subjects

38 CFR Part 19

Administrative practice and procedure, Claims, Veterans.

38 CFR Part 20

Administrative practice and procedure, Claims, Lawyers, Legal services, Veterans.

Approved: September 27, 2001.

Anthony J. Principi,

Secretary of Veterans Affairs.

For the reasons set out in the preamble, 38 CFR parts 19 and 20 are amended as follows:

PART 19—BOARD OF VETERANS' APPEALS: APPEALS REGULATIONS

1. The authority citation for part 19 continues to read as follows:

Authority: 38 U.S.C. 501(a), unless otherwise noted.

2. Section 19.35 is amended by revising the first sentence to read as follows:

§ 19.35 Certification of appeals.

Following receipt of a timely Substantive Appeal, the agency of original jurisdiction will certify the case to the Board of Veterans' Appeals.

* * *

* * * * *

PART 20—BOARD OF VETERANS' APPEALS: RULES OF PRACTICE

3. The authority citation for part 20 continues to read as follows:

Authority: 38 U.S.C. 501(a) and as noted in specific sections.

4. Section 20.101 amended by revising paragraph (c), and adding paragraphs (d) and (e), to read as follows:

§ 20.101 Rule 101. Jurisdiction of the Board.

* * * * *

(c) *Appeals as to jurisdiction.* All claimants have the right to appeal a determination made by the agency of original jurisdiction that the Board does not have jurisdictional authority to review a particular case. Jurisdictional questions which a claimant may appeal, include, but are not limited to, questions relating to the timely filing and adequacy of the Notice of Disagreement and the Substantive Appeal.

(d) *Authority to determine jurisdiction.* The Board may address questions pertaining to its jurisdictional authority to review a particular case, including, but not limited to, determining whether Notices of Disagreement and Substantive Appeals are adequate and timely, at any stage in a proceeding before it, regardless of whether the agency of original jurisdiction addressed such question(s). When the Board, on its own initiative, raises a question as to a potential jurisdictional defect, all parties to the proceeding and their representative(s), if any, will be given notice of the potential jurisdictional defect(s) and granted a period of 60 days following the date on which such notice is mailed to present written argument and additional evidence relevant to jurisdiction and to request a hearing to present oral