

Issued in Renton, Washington, on November 28, 2001.

**Vi L. Lipski,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-30197 Filed 12-11-01; 8:45 am]

BILLING CODE 4910-13-U

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2001-NM-95-AD; Amendment 39-12537; AD 2001-24-20]

RIN 2120-AA64

#### **Airworthiness Directives; McDonnell Douglas Model DC-10-10, -15, -30, -30F (KC-10A and KDC-10 Military), and -40 Series Airplanes; and Model MD-10-10F Series Airplanes**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model DC-10-10, -15, -30, -30F (KC-10A and KDC-10 military), and -40 series airplanes; and Model MD-10-10F series airplanes, that requires an inspection to verify that the wire connections at circuit breakers are properly connected, and correction of any incorrect wire connection at the circuit breakers. This amendment is necessary to prevent loss of protection by the circuit breakers in the flight engineer's equipment panel due to improperly wired connections at the circuit breakers, which could result in wire damage and could lead to smoke and/or fire in the cockpit. This action is intended to address the identified unsafe condition.

**DATES:** Effective January 16, 2002.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 16, 2002.

**ADDRESSES:** The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles

Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### **FOR FURTHER INFORMATION CONTACT:**

Natalie Phan-Tran, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5343; fax (562) 627-5210.

#### **SUPPLEMENTARY INFORMATION:**

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model DC-10-10, -15, -30, -30F (KC-10A and KDC-10 military), and -40 series airplanes; and Model MD-10-10F series airplanes, was published in the **Federal Register** on July 23, 2001 (66 FR 38185). That action proposed to require an inspection to verify that the wire connections at circuit breakers are properly connected, and correction of any incorrect wire connection at the circuit breakers.

#### **Comments**

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

#### **Conclusion**

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

#### **Cost Impact**

There are approximately 352 Model DC-10-10, -15, -30, -30F (KC-10A and KDC-10 military), and -40 series airplanes; and Model MD-10-10F series airplanes of the affected design in the worldwide fleet. The FAA estimates that 259 airplanes of U.S. registry will be affected by this AD, that it will take approximately 1 work hour per airplane to accomplish the required inspection, and that the average labor rate is \$60 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$15,540, or \$60 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions

actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

#### **Regulatory Impact**

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

#### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### **Adoption of the Amendment**

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### **PART 39—AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### **§ 39.13 [Amended]**

2. Section 39.13 is amended by adding the following new airworthiness directive:

#### **2001-24-20 McDonnell Douglas:**

Amendment 39-12537. Docket 2001-NM-95-AD.

*Applicability:* Model DC-10-10, -15, -30, -30F (KC-10A and KDC-10 military), and -40 series airplanes; and Model MD-10-10F series airplanes, as listed in Boeing Alert Service Bulletin DC10-24A130, Revision 01, dated March 12, 2001; certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent loss of protection by the circuit breakers in the flight engineer's equipment panel due to improperly wired connections at the circuit breakers, which could result in wire damage and could lead to smoke and/or fire in the cockpit, accomplish the following:

#### Inspection, and Corrective Action, If Necessary

(a) Within 1 year after the effective date of this AD, do a general visual inspection to verify that the wire connections at circuit breakers are properly connected, per Boeing Alert Service Bulletin DC10-24A130, Revision 01, dated March 12, 2001. If any wire connection at a circuit breaker is found improperly connected, before further flight, correct that wire connection at the circuit breaker per the service bulletin.

**Note 2:** For the purposes of this AD, a general visual inspection is defined as "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or drop-light, and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

**Note 3:** Inspection and correction of improper wire connection done before the effective date of this AD per Boeing (McDonnell Douglas) Service Bulletin DC10-24-130, dated October 2, 1985, are considered acceptable for the requirements of this AD.

#### Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

**Note 4:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

#### Special Flight Permit

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

#### Incorporation by Reference

(d) The actions shall be done in accordance with Boeing Alert Service Bulletin DC10-24A130, Revision 01, dated March 12, 2001. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### Effective Date

(e) This amendment becomes effective on January 16, 2002.

Issued in Renton, Washington, on November 28, 2001.

**Vi L. Lipski,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-30196 Filed 12-11-01; 8:45 am]

**BILLING CODE 4910-13-U**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 99-NM-297-AD; Amendment 39-12536; AD 2001-24-19]

RIN 2120-AA64

#### **Airworthiness Directives; McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 Series Airplanes; C-9 Airplanes; Model DC-9-81, -82, -83, and -87 Series Airplanes; and Model MD-88 Airplanes**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 series airplanes; C-9 airplanes; Model DC-9-81, -82, -83, and -87 series airplanes; and Model MD-88 airplanes, that requires an inspection to detect chafing or overheat damage of the

electrical wires located at fuselage station Y=110.000 bulkhead of the lower nose left tunnel; and corrective actions, if necessary. This AD also requires replacing the external power ground stud with a new ground stud using new attaching parts, torquing new attachments, and installing a nameplate. This action is necessary to prevent loose external power ground wires, which could cause arcing and overheated wire insulation and consequent smoke/fire in the cockpit. This action is intended to address the identified unsafe condition.

**DATES:** Effective January 16 2002.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 16, 2002.

**ADDRESSES:** The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

#### FOR FURTHER INFORMATION CONTACT:

Elvin Wheeler, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5344; fax (562) 627-5210.

#### SUPPLEMENTARY INFORMATION:

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model DC-9-10, -20, -30, -40, and -50 series airplanes; C-9 airplanes; Model DC-9-81, -82, -83, and -87 series airplanes; and Model MD-88 airplanes was published in the **Federal Register** on July 23, 2001 (66 FR 38183). That action proposed to require an inspection to detect chafing or overheat damage of the electrical wires located at fuselage station Y=110.000 bulkhead of the lower nose left tunnel; and corrective actions, if necessary. That action also proposed to require replacing the external power ground stud with a new ground stud using new attaching parts, torquing new attachments, and installing a nameplate.