

2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and

3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**Boeing:** Docket No. FAA-2007-28355; Directorate Identifier 2007-NM-062-AD.

#### Comments Due Date

(a) The FAA must receive comments on this AD action by July 23, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Boeing Model 737-600, -700, -700C, -800 and -900 series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 737-28-1257, dated February 26, 2007.

#### Unsafe Condition

(d) This AD results from a report of random flashes of the six fuel pump low pressure lights and intermittent operation of the fuel boost pumps. We are issuing this AD to prevent the simultaneous malfunction of all six fuel boost pumps, which could cause the engines to operate on suction feed and potentially flame out.

#### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Inspection

(f) Within 24 months after the effective date of this AD: Do a general visual

inspection of ground blocks GD261 and GD264 for corrosion, measure the electrical bond resistance, and separate the ground wires for the fuel boost pump circuit between ground blocks GD261 and GD264. Do these actions in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 737-28-1257, dated February 26, 2007. Do applicable corrective actions before further flight in accordance with the service bulletin.

#### Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Issued in Renton, Washington, on May 25, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-10878 Filed 6-5-07; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2007-28353; Directorate Identifier 2007-NM-065-AD]**

**RIN 2120-AA64**

#### Airworthiness Directives; Gulfstream Aerospace LP Model Galaxy Airplanes and Model Gulfstream 200 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

During the manufacturing process of the Poppet Covers of the Pressurization Safety Valves, burrs that could damage the Valve Diaphragms were not removed. The damage may eventually cause faulty operation of the relief valves resulting in an unsafe condition

when combined with additional failures. The serial numbers of the defective valves and the affected aircraft were identified.

The unsafe condition is damage and subsequent failure of the safety relief valves, which could result in rapid decompression of the airplane. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by July 6, 2007.

**ADDRESSES:** You may send comments by any of the following methods:

- **DOT Docket Web Site:** Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- **Fax:** (202) 493-2251.

- **Mail:** Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.

- **Hand Delivery:** Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

- **Federal eRulemaking Portal:** <http://www.regulations.gov>. Follow the instructions for submitting comments.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Mike Borfitz, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Streamlined Issuance of AD

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. This streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet

our technical decision-making responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This proposed AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The proposed AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2007-28353; Directorate Identifier 2007-NM-065-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The Civil Aviation Authority of Israel (CAAI), which is the aviation authority for Israel, has issued Israeli Airworthiness Directive 21-07-01-01, dated February 20, 2007 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

During the manufacturing process of the Poppet Covers of the Pressurization Safety Valves, burrs that could damage the Valve Diaphragms were not removed. The damage may eventually cause faulty operation of the relief valves resulting in an unsafe condition when combined with additional failures. The serial numbers of the defective valves and the affected aircraft were identified.

The unsafe condition is damage and subsequent failure of the safety relief valves, which could result in rapid decompression of the airplane. The corrective action includes replacing the pressurization safety valve, part number 103842-3. You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

Gulfstream has issued Service Bulletin 200-21-308, dated February 23, 2007. The actions described in this service information are intended to

correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 7 products of U.S. registry. We also estimate that it would take about 10 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$80 per work-hour. Required parts would cost about \$0 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these costs. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$5,600, or \$800 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more

detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

**Gulfstream Aerospace LP (Formerly Israel Aircraft Industries, Ltd.);** Docket No. FAA-2007-28353; Directorate Identifier 2007-NM-065-AD.

**Comments Due Date**

(a) We must receive comments by July 6, 2007.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to Gulfstream Model Galaxy airplanes and Model Gulfstream 200 airplanes, serial numbers 101 through 104, 109, 110, and 118, certificated in any category.

**Subject**

(d) Air Conditioning.

**Reason**

(e) The mandatory continuing airworthiness information (MCAI) states:

During the manufacturing process of the Poppet Covers of the Pressurization Safety Valves, burrs that could damage the Valve Diaphragms were not removed. The damage may eventually cause faulty operation of the relief valves resulting in an unsafe condition when combined with additional failures. The serial numbers of the defective valves and the affected aircraft were identified.

The unsafe condition is damage and subsequent failure of the safety relief valves, which could result in rapid decompression of the airplane. The corrective action includes replacing the pressurization safety valve, part number 103842-3.

**Actions and Compliance**

(f) Unless already done, do the following actions. Within 500 flight hours or 12 months after the effective date of this AD, whichever occurs first: Replace the pressurization safety valve, part number 103842-3, according to Gulfstream Service Bulletin 200-21-308, dated February 23, 2007.

**FAA AD Differences**

**Note:** This AD differs from the MCAI and/or service information as follows: No differences.

**Other FAA AD Provisions**

(g) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Borfritz, Aerospace Engineer, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

**Related Information**

(h) Refer to MCAI Israeli Airworthiness Directive 21-07-01-01, dated February 20, 2007; and Gulfstream Service Bulletin 200-21-308, dated February 23, 2007; and Honeywell Service Bulletin 103842-21-4126, dated December 5, 2006; for related information.

Issued in Renton, Washington, on May 25, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-10869 Filed 6-5-07; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2006-26043; Directorate Identifier 2005-NM-010-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; McDonnell Douglas Model 717-200 Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Supplemental notice of proposed rulemaking (NPRM); reopening of comment period.

**SUMMARY:** The FAA is revising an earlier proposed airworthiness directive (AD) for all McDonnell Douglas Model 717-200 airplanes. The original NPRM would have required inspecting the power conversion distribution unit (PCDU) to determine its part number, and modifying certain PCDUs. The original NPRM was prompted by reports of failed PCDUs, the loss of an electrical bus, and the presence of a strong electrical burning odor in the flight deck and forward cabin. This action revises the original NPRM by reidentifying the part number reference for the proposed corrective action. We are proposing this supplemental NPRM to prevent the loss of an electrical bus due to PCDU failure, resulting in the loss of all flight displays for an unacceptable time period, and consequent emergency landing.

**DATES:** We must receive comments on this supplemental NPRM by July 2, 2007.

**ADDRESSES:** Use one of the following addresses to submit comments on this supplemental NPRM.

• *DOT Docket Web site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

• *Government-wide rulemaking web site:* Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.

• *Mail:* Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590.

• *Fax:* (202) 493-2251.

• *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Long Beach Division, Dept. C1-L5A (D800-0024), for service information identified in this proposed AD.

**FOR FURTHER INFORMATION CONTACT:**

Thomas Phan, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5342; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to submit any relevant written data, views, or arguments regarding this supplemental NPRM. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number "Docket No. FAA-2006-26043; Directorate Identifier 2005-NM-010-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this supplemental NPRM. We will consider all comments received by the closing date and may amend this supplemental NPRM in light of those comments.

We will post all comments submitted, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this supplemental NPRM. Using the search function of that Web site, anyone can find and read the comments in any of our dockets, including the name of the individual who sent the comment (or signed the comment on behalf of an