

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: If any Airbus service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (I) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015-0008, dated January 15, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-3983.

(2) For Airbus service information identified in this proposed AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. For Hamilton Sundstrand service information identified in this AD, contact Hamilton Sundstrand, Technical Publications, Mail Stop 302-9, 4747 Harrison Avenue, P.O. Box 7002, Rockford, IL 61125-7002; telephone 860-654-3575; fax 860-998-4564; email [tech.solutions@hs.utc.com](mailto:tech.solutions@hs.utc.com); Internet <http://www.hamiltonsundstrand.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on February 19, 2016.

**Dorr M. Anderson,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-04288 Filed 2-29-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2016-3988; Directorate Identifier 2015-NM-130-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A330-200, -200 Freighter, and -300 series airplanes; and all Airbus Model A340-200, -300, -500, and -600 series airplanes. This proposed AD was prompted by reports of chafing of the feeder cable at the pylon-wing junction due to vibration; one report revealed that the cable loom plastic support bracket of the G-route was broken due to vibration; and another report revealed wire chafing due to clamp damage. This proposed AD would require modifying the cable loom support bracket of the G-route of the inboard pylons at the pylon-wing junction. We are proposing this AD to prevent chafing of the wiring in the pylon-wing area, which could result in an electrical short circuit near a flammable fluid vapor zone, and consequent fire or fuel tank explosion.

**DATES:** We must receive comments on this proposed AD by April 15, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax*: 202-493-2251.
- *Mail*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery*: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email

[airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-3988; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1138; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-3988; Directorate Identifier 2015-NM-130-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015-0142, dated July 17, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus Model A330-200, -200 Freighter, and

–300 series airplanes; and all Airbus Model A340–200, –300, –500, and –600 series airplanes. The MCAI states:

Two events have been reported of feeder cable chafing at the pylon-wing junction on A330 aeroplanes. Inspection of the affected area for the first event revealed that the bracket supporting the cables G-route, made in plastic, was broken. The second event was due to clamp damage. Failure of support bracket and/or damage of clamp led to the feeder cables gradually chafing away at the cut-out edge by vibration. Due to design similarity, A340 aeroplanes are also affected by this issue.

This condition, if not corrected, could create a short circuit, in combination with fuel vapour on [the] ground, possibly resulting in a fire or explosion.

To address this unsafe condition, Airbus developed modifications to be embodied in service through Airbus Service Bulletin (SB) A330–92–3132, SB A340–92–4100 or SB A340–92–5066, as applicable to aeroplane type and model.

For the reasons described above, this [EASA] AD requires the embodiment of these modifications [of the cable loom support bracket of the G-route of the inboard pylons] at the pylon/wing junction in [left-hand] LH and [right-hand] RH wings.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–3988.

#### Related Service Information Under 14 CFR Part 51

Airbus has issued the following service information:

- Service Bulletin A330–92–3132, Revision 01, dated May 21, 2015.
- Service Bulletin A340–92–4100, Revision 01, dated May 21, 2015.
- Service Bulletin A340–92–5066, dated June 25, 2014.

The service information describes procedures for modifying the cable loom support bracket of the G-route of the inboard pylons at the pylon-wing junction. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe

condition exists and is likely to exist or develop on other products of these same type designs.

#### Costs of Compliance

We estimate that this proposed AD affects 90 airplanes of U.S. registry.

We also estimate that it would take about 8 work-hours per product to comply with the modification requirements of this proposed AD. Required parts would cost about \$900 per product. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost for the inspection specified in this proposed AD on U.S. operators to be \$142,200, or \$1,580 per product.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;

2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2016–3988;

Directorate Identifier 2015–NM–130–AD.

##### (a) Comments Due Date

We must receive comments by April 15, 2016.

##### (b) Affected ADs

None.

##### (c) Applicability

This AD applies to the airplanes identified in paragraphs (c)(1) and (c)(2) of this AD, certificated in any category, all manufacturer serial numbers.

(1) Airbus Model A330–201, –202, –203, –223, –223F, –243, –243F, –301, –302, –303, –321, –322, –323, –341, –342, and –343 airplanes; except airplanes on which Airbus Modification 203672 has been embodied in production.

(2) Airbus Model A340–211, –212, –213, –311, –312, –313, –541, and –642 airplanes.

##### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

##### (e) Reason

This AD was prompted by reports of chafing of the feeder cable at the pylon-wing junction due to vibration; one report revealed that the cable loom plastic support bracket of the G-route was broken due to vibration; and another report revealed wire chafing due to clamp damage. We are issuing this AD to prevent chafing of the wiring in the pylon-wing area, which could result in an electrical short circuit near a flammable fluid vapor zone, and consequent fire or fuel tank explosion.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Modification of the Feeder Cable**

Within 18 months after the effective date of this AD: Modify the cable loom support bracket of the G-route 7701VB in the left-hand side of the inboard pylon, and the G-route 7702VB in the right-hand side of the inboard pylon, located at the pylon-wing junction, in accordance with the applicable service information specified in paragraphs (g)(1), (g)(2), and (g)(3) of this AD.

(1) Airbus Service Bulletin A330-92-3132, Revision 01, dated May 21, 2015.

(2) Airbus Service Bulletin A340-92-4100, Revision 01, dated May 21, 2015.

(3) Airbus Service Bulletin A340-92-5066, dated June 25, 2014.

**(h) Credit for Previous Actions**

This paragraph provides credit for the modification required by paragraph (g) of this AD, if the modification was performed before the effective date of this AD using Airbus Service Bulletin A330-92-3132, dated June 19, 2014; or Airbus Service Bulletin A340-92-4100, dated June 19, 2014; as applicable.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1138; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified

as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015-0142, dated July 17, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-3988.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on February 19, 2016.

**Dorr M. Anderson,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-04296 Filed 2-29-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

**[Docket No. FAA-2016-0021; Airspace Docket No. 16-ANM-1]**

**Proposed Amendment of Class E Airspace; Ogden-Hinckley, UT**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to modify the Class E airspace extending upward from the surface designated as an extension to the Class D surface area at Ogden-Hinckley Airport, Ogden, UT. The FAA's Aeronautical Information Services identified that the width of the Class E extension to the Class D surface area did not meet the current criteria. This action would enhance the safety and management of Standard Instrument Approach Procedures (SIAPs) for Instrument Flight Rules (IFR) operations at the airport.

**DATES:** Comments must be received on or before April 15, 2016.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590; telephone (202) 366-9826. You must identify FAA Docket No. FAA-2016-0021; Airspace Docket No. 16-ANM-1, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1-800-647-5527), is on the ground floor of the building at the above address.

FAA Order 7400.9Z, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 29591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.9Z at NARA, call 202-741-6030, or go to [http://www.archives.gov/federal-register/code\\_of\\_federal-regulations/ibr\\_locations.html](http://www.archives.gov/federal-register/code_of_federal-regulations/ibr_locations.html).

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:**

Turan Wright, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone: 425-203-4533.

**SUPPLEMENTARY INFORMATION:****Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the