

1. **Lender Fees:** An SBA Express Lender must not impose any fees or direct costs on an Express Bridge Pilot Applicant or Borrower, except for the following:

a. **Application Fee:** SBA Express Lenders may charge an Express Bridge Pilot Applicant an application fee. The maximum permissible application fee is 2% of the loan amount or \$250, whichever is greater. If an application fee is charged, it must be disclosed on SBA Form 159(7a), Fee Disclosure Form and Compensation Agreement for Agent Services in Connection with a SBA 7(a) Loan. If an undisbursed loan is canceled, the Lender may retain the application fee;

b. **Late Payment Fee:** A late payment fee not to exceed 5 percent of the scheduled Express Bridge Pilot loan payment; and

c. **Liquidation Costs:** The reasonable direct costs of liquidation.

2. **Prohibition on all other fees and charges, including by loan packagers, referral agents or brokers.** Except as permitted in 1. above, no other fee or costs may be charged to an Express Bridge Pilot Applicant or Borrower by the Lender. In addition, no fee or costs may be charged to an Express Bridge Pilot Applicant or Borrower by any third party in connection with an Express Bridge Pilot loan, including any referral fee, broker's fee, or similar fee.

The modification of this regulation will permit SBA Express lenders to recoup some of their costs in processing the application, without subjecting the Applicant to excessive or unnecessary fees for these small guaranteed loans that are intended to provide immediate cash to assist the small business with rebuilding and continuing or restarting its operations while awaiting long-term disaster financing. SBA believes that the costs of the program should be kept as low as possible to aid the disaster-affected small business. The application fee is optional; therefore an SBA Express Lender may choose not to collect an application fee from an Express Bridge Pilot Applicant. Additionally, because an Express Bridge Pilot loan Applicant must have had an existing banking relationship with the SBA Express lender, there is no need for either the Applicant or the Lender to pay a referral fee, broker's fee, or similar fee for these loans.

SBA's modification of 13 CFR 120.221 is authorized by 13 CFR 120.3 of its regulations, which provides that the SBA Administrator may suspend, modify or waive rules for a limited period of time to test new programs or ideas. This modification applies only to loans made under the Express Bridge

Pilot and will last only for the duration of the pilot, which expires September 30, 2020. As part of the Express Bridge Pilot, this modification applies only to those small businesses that were located, as of the date of the applicable disaster, in counties that have been Presidentially-declared as disaster areas, plus any contiguous counties. A listing of Presidentially-declared disaster declarations, including primary and contiguous counties can be located at [www.sba.gov/disaster](http://www.sba.gov/disaster).

All other SBA terms and conditions and regulatory waivers related to the Express Bridge Pilot remain unchanged.

SBA will provide more detailed guidance in the form of a program guide, which will be available on SBA's website, <http://www.sba.gov>. SBA may also provide additional guidance, if needed, through SBA notices, which also will be published on SBA's website, <http://www.sba.gov>.

**Authority:** 15 U.S.C. 636(a)(25); 13 CFR 120.3.

Dated: April 26, 2018.

**Linda E. McMahon,**  
Administrator.

[FR Doc. 2018-09627 Filed 5-4-18; 8:45 am]

**BILLING CODE 8025-01-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2017-1163; Product Identifier 2017-CE-041-AD; Amendment 39-19260; AD 2018-09-04]

**RIN 2120-AA64**

#### Airworthiness Directives; Gulfstream Aerospace Corporation Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Gulfstream Aerospace Corporation Models G-IV and GIV-X airplanes. This AD was prompted by the potential for fatigue cracks developing in the main landing gear actuator attachment fitting that had a certain repair incorporated. This AD requires incorporating new revisions into the Instructions for Continued Airworthiness of the Limitations section of the FAA-approved maintenance program (e.g., maintenance manual) that establish an inspection cycle for the repaired MLG side brace actuator fittings. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective June 11, 2018.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of June 11, 2018.

**ADDRESSES:** For service information identified in this final rule, contact Gulfstream Aerospace Corporation, P.O. Box 2206, Savannah, Georgia 31402-2206; telephone: (800) 810-4853; fax 912-965-3520; email: [pubs@gulfstream.com](mailto:pubs@gulfstream.com); internet: [http://www.gulfstream.com/product\\_support/technical\\_pubs/pubs/index.htm](http://www.gulfstream.com/product_support/technical_pubs/pubs/index.htm). You may view this service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1163.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1163; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations (phone: 800-647-5527) is Docket Operations, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

William O. Herderich, Aerospace Engineer, Atlanta ACO Branch, FAA, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5547; fax: (404) 474-5605; email: [william.o.herderich@faa.gov](mailto:william.o.herderich@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Gulfstream Aerospace Corporation Models G-IV and GIV-X airplanes. The NPRM published in the **Federal Register** on December 12, 2017 (82 FR 58362). The NPRM was prompted by the potential for fatigue cracks developing in the main landing gear actuator attachment fitting that had a certain repair incorporated. The NPRM proposed to require incorporating new revisions into the

Instructions for Continued Airworthiness of the Limitations section of the FAA-approved maintenance program (*e.g.*, maintenance manual) that establish an inspection cycle for the repaired MLG side brace actuator fittings. We are issuing this AD to address the unsafe condition on these products.

#### Comments

We gave the public the opportunity to participate in developing this final rule. The following presents the comment received on the NPRM and the FAA's response to the comment.

#### Request To Change Compliance Time

Gulfstream Aerospace Corporation stated that the compliance time for the actions required in the proposed AD should be changed to be in-line with the service information incorporated by reference in the proposed AD.

Gulfstream Aerospace Corporation stated that the compliance time specified in the service information incorporated by reference in the proposed AD is 24 months from September 16, 2016. Gulfstream Aerospace Corporation believes that the 100-hour time-in-service (TIS) compliance time after the effective date of the proposed AD significantly reduces the original compliance time and may cause an undue burden on the owner/operators of the affected airplanes.

We agree that the compliance time can be changed to more fully coincide with the service bulletin without affecting the safety risk of this AD. We have changed the compliance time of this AD to "Within the next 100 hours

time-in-service (TIS) after the effective date of this AD or within the next 3 months after the effective date of this AD, whichever occurs later." The 3-month compliance time combined with the 35 days after publication in the **Federal Register** effective date should coincide with the compliance time in the service bulletin.

#### Conclusion

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this final rule as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

#### Related Service Information Under 1 CFR Part 51

We reviewed Gulfstream G350 Customer Bulletin Number 192A, dated June 15, 2017, including Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016 (for model Gulfstream G350); Gulfstream G450 Customer Bulletin 192A, dated June 15, 2017, including Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016 (for model Gulfstream G450); Gulfstream IV Customer Bulletin

Number 238A, dated June 15, 2017, including Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016 (for model Gulfstream IV); Gulfstream G300 Customer Bulletin Number 238A, dated June 15, 2017, including Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016 (for model Gulfstream G300); and Gulfstream G400 Customer Bulletin Number 238A, dated June 15, 2017, including Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016 (for model Gulfstream G400). For the applicable models, the service information describes procedures for inspecting maintenance records to determine if repair SE05732102 for the main landing gear side brace fitting has been incorporated and determining initial and repetitive inspection requirements for the main landing gear side brace fitting. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### Costs of Compliance

We estimate that this AD affects 709 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspect Maintenance Records .....	1 work-hour × \$85 per hour = \$85 ....	Not applicable ...	\$85	\$60,265
Incorporate new revisions into the Instructions for Continued Airworthiness of the Limitations section of the FAA-approved maintenance program ( <i>e.g.</i> , maintenance manual).	1 work-hour × \$85 per hour = \$85 ....	Not applicable ...	85	60,265

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII,

Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs

applicable to small airplanes, gliders, domestic business jet transport airplanes, and associated appliances to the Director of the Policy and Innovation Division.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2018–09–04 Gulfstream Aerospace Corporation:** Amendment 39–19260; Docket No. FAA–2017–1163; Product Identifier 2017–CE–041–AD.

#### (a) Effective Date

This AD is effective June 11, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the following Gulfstream Aerospace Corporation model airplanes that are certificated in any category:

- (1) Model G–IV, serial numbers (S/Ns) 1000 through 1399 having Aircraft Service

Change (ASC) 416A (MSG–3) incorporated; and S/Ns 1400 through 1535; and

- (2) Model GIV–X, S/Ns 4001 through 4355.

#### (d) Subject

Joint Aircraft System Component (JASC)/Air Transport Association (ATA) of America Code 32, Landing Gear.

#### (e) Unsafe Condition

This AD was prompted by the potential for fatigue cracks in the main landing gear (MLG) actuator attachment fitting that had a certain repair incorporated. We are issuing this AD to prevent failure of the MLG actuator attachment. The unsafe condition, if not addressed, could compromise the lateral support of the MLG during ground maneuvers, possibly leading to collapse of the affected MLG with consequent loss of control. In addition, this condition could also cause the MLG side brace to fail, which could result in a penetration of the wing fuel tank causing an uncontained fire.

#### (f) Compliance

At whichever of the following in paragraphs (f)(1) and (f)(2) that occurs later, comply with the actions in paragraphs (g) through (i) of this AD, unless already done.

- (1) Within the next 100 hours time-in-service after June 11, 2018 (the effective date of this AD); or
- (2) Within the next 3 months after June 11, 2018 (the effective date of this AD).

#### (g) Inspect Maintenance Records

Inspect the airplane maintenance records to determine if repair SE05732102 for the MLG side brace fitting has been incorporated. To do this inspection, use the Accomplishment Instructions in Gulfstream G350 Customer Bulletin Number 192A; Gulfstream G450 Customer Bulletin 192A; Gulfstream IV Customer Bulletin Number 238A; Gulfstream G300 Customer Bulletin Number 238A; and Gulfstream G400 Customer Bulletin Number 238A; all dated June 15, 2017, as applicable. The service information referenced in this paragraph specifies sending a service reply card back to Gulfstream Aerospace Corporation if repair SE05732102 for the MLG side brace fitting has been not been incorporated. This action is not required in this AD.

#### (h) Determine Initial and Repetitive Inspection Requirements

If it is determined during the maintenance records inspection required in paragraph (g) of this AD that repair SE05732102 for the MLG side brace fitting has been incorporated, determine the initial and repetitive inspection requirements using the Accomplishment Instructions of the service information identified in paragraph (g) of this AD along with the following documents, as applicable. Comply with the inspection requirements as determined.

- (1) Appendix A, Gulfstream Document GIV–SGER–553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016, to Gulfstream G350 Customer Bulletin No. 192A, dated June 15, 2017;

- (2) Appendix A, Gulfstream Document GIV–SGER–553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016, to Gulfstream G450 Customer Bulletin No. 192A, dated June 15, 2017;

- (3) Appendix A, Gulfstream Document GIV–SGER–553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016, to Gulfstream IV Customer Bulletin No. 283A, dated June 15, 2017;

- (4) Appendix A, Gulfstream Document GIV–SGER–553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016, to Gulfstream G300 Customer Bulletin No. 283A, dated June 15, 2017; and

- (5) Appendix A, Gulfstream Document GIV–SGER–553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016, to Gulfstream G400 Customer Bulletin No. 283A, dated June 15, 2017.

#### (i) Revise Limitations Section

Insert the documents listed in paragraphs (h)(1) through (5) of this AD into the Instructions for Continued Airworthiness of the Limitations section of the FAA-approved maintenance program (e.g., maintenance manual), as applicable. The revised limitations sections establish inspections of the repaired MLG side brace actuator fittings.

#### (j) Alternative Methods of Compliance (AMOCs)

- (1) The Manager, Atlanta ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k) of this AD.

- (2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

- (3) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (g) through (i) of this AD apply.

- (i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

- (ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(k) Related Information**

For more information about this AD, contact William O. Herderich, Aerospace Engineer, Atlanta ACO Branch, FAA, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5547; fax: (404) 474-5605; email: [william.o.herderich@faa.gov](mailto:william.o.herderich@faa.gov).

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Gulfstream G350 Customer Bulletin Number 192A, dated June 15, 2017, that incorporates Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016.

(ii) Gulfstream G450 Customer Bulletin 192A, dated June 15, 2017, that incorporates Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016.

(iii) Gulfstream IV Customer Bulletin Number 238A, dated June 15, 2017, that incorporates Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016.

(iv) Gulfstream G300 Customer Bulletin Number 238A, dated June 15, 2017, that incorporates Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016.

(v) Gulfstream G400 Customer Bulletin Number 238A, dated June 15, 2017, that incorporates Appendix A, Gulfstream Document GIV-SGER-553, Revision A, Instructions for Continued Airworthiness for Gulfstream Repair Drawing SE05732102, dated December 14, 2016.

(3) For Gulfstream Aerospace Corporation service information identified in this AD, contact Gulfstream Aerospace Corporation, P.O. Box 2206, Savannah, Georgia 31402-2206; telephone: (800) 810-4853; fax 912-965-3520; email: [pubs@gulfstream.com](mailto:pubs@gulfstream.com); internet: [http://www.gulfstream.com/product\\_support/technical\\_pubs/pubs/index.htm](http://www.gulfstream.com/product_support/technical_pubs/pubs/index.htm).

(4) You may view this service information at FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on April 19, 2018.

**Melvin Johnson,**

*Deputy Director, Policy and Innovation Division, Aircraft Certification Service.*

[FR Doc. 2018-08956 Filed 5-4-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2017-1245; Product Identifier 2017-NM-099-AD; Amendment 39-19266; AD 2018-09-09]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Airbus Model A318 series airplanes and Model A319 series airplanes; all Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and all Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. This AD was prompted by an evaluation by the design approval holder (DAH) indicating that the holes of the upper cleat to upper stringer attachments at certain areas of the left- and right-hand wings are subject to widespread fatigue damage (WFD). This AD requires modifying the holes of the upper cleat to upper stringer attachments at certain areas of the left- and right-hand wings. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective June 11, 2018.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 11, 2018.

**ADDRESSES:** For service information identified in this final rule, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone: +33 5 61 93 36 96; fax: +33 5 61 93 44 51; email: [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); internet: <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at

<http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1245.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1245; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223.

**SUPPLEMENTARY INFORMATION:****Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Airbus Model A318 series airplanes and Model A319 series airplanes; all Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and all Model A321-111, -112, -131, -211, -212, -213, and -232 airplanes. The NPRM published in the **Federal Register** on January 12, 2018 (83 FR 1579) ("the NPRM"). The NPRM was prompted by an evaluation by the DAH indicating that the holes of the upper cleat to upper stringer attachments at certain areas of the left- and right-hand wings are subject to WFD. The NPRM proposed to require modifying the holes of the upper cleat to upper stringer attachments at certain areas of the left- and right-hand wings. We are issuing this AD to prevent fatigue cracking in the stringer attachment holes of the wings, which could result in reduced structural integrity of the wings.

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2017-0117, dated July 7, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus Model A318 series airplanes and Model A319 series