

*code\_of\_federal\_regulations/  
ibr\_locations.html.*

Issued in Renton, Washington, on August 16, 2006.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane  
Directorate, Aircraft Certification Service.*

[FR Doc. E6-13969 Filed 8-24-06; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2006-24999; Directorate Identifier 2006-NM-060-AD; Amendment 39-14736; AD 2006-17-15]

**RIN 2120-AA64**

#### **Airworthiness Directives; McDonnell Douglas Model DC-10-10 and DC-10-10F Airplanes; and Model MD-10-10F Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain McDonnell Douglas Model DC-10-10 and DC-10-10F airplanes; and Model MD-10-10F airplanes. This AD requires replacing the clamp bases for the fuel vent pipe with improved clamp bases. This AD results from reports that the foil wrapping on existing plastic clamp bases has migrated out of position, which compromises the bonding of the fuel vent pipes to the airplane structure. We are issuing this AD to ensure that the fuel vent pipes are properly bonded to the airplane structure. Improper bonding could prevent electrical energy from a lightning strike from dissipating to the airplane structure, and create an ignition source, which could result in a fuel tank explosion.

**DATES:** This AD becomes effective September 29, 2006.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of September 29, 2006.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and

Service Management, Dept. C1-L5A (D800-0024), for service information identified in this AD.

**FOR FURTHER INFORMATION CONTACT:** Serj Harutunian, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5254; fax (562) 627-5210.

#### **SUPPLEMENTARY INFORMATION:**

##### **Examining the Docket**

You may examine the airworthiness directive (AD) docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the street address stated in the **ADDRESSES** section.

##### **Discussion**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to certain McDonnell Douglas Model DC-10-10 and DC-10-10F airplanes; and Model MD-10-10F airplanes. That NPRM was published in the **Federal Register** on June 12, 2006 (71 FR 33663). That NPRM proposed to require replacing the clamp bases for the fuel vent pipe with improved clamp bases.

##### **Comments**

We provided the public the opportunity to participate in the development of this AD. We received no comments on the NPRM or on the determination of the cost to the public.

##### **Conclusion**

We have carefully reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.

##### **Costs of Compliance**

There are about 12 airplanes of the affected design in the worldwide fleet. This AD will affect about 12 airplanes of U.S. registry. The required actions will take about 2 work hours per airplane, at an average labor rate of \$80 per work hour. Required parts will cost about \$502 per airplane. Based on these figures, the estimated cost of this AD for U.S. operators is \$7,944, or \$662 per airplane.

##### **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue

rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

##### **Regulatory Findings**

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

##### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

##### **Adoption of the Amendment**

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### **PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**2006-17-15 McDonnell Douglas:**  
Amendment 39-14736. Docket No. FAA-2006-24999; Directorate Identifier 2006-NM-060-AD.

**Effective Date**

(a) This AD becomes effective September 29, 2006.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to McDonnell Douglas Model DC-10-10 and DC-10-10F airplanes; and Model MD-10-10F airplanes, certificated in any category; as identified in Boeing Service Bulletin DC10-28-243, dated February 22, 2005.

**Unsafe Condition**

(d) This AD results from reports that the foil wrapping on existing plastic clamp bases has migrated out of position, which compromises the bonding of the fuel vent pipes to the airplane structure. We are issuing this AD to ensure that the fuel vent pipes are properly bonded to the airplane structure. Improper bonding could prevent electrical energy from a lightning strike from dissipating to the airplane structure, and create an ignition source, which could result in a fuel tank explosion.

**Compliance**

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Clamp Base Replacement**

(f) Within 60 months after the effective date of this AD: Replace the existing plastic clamp bases for the fuel vent pipe with improved metal clamp bases, by doing all of the applicable actions as specified in the Accomplishment Instructions of Boeing Service Bulletin DC10-28-243, dated February 22, 2005. All corrective actions that are required following the conductivity verification, which is included in the replacement procedures, must be done before further flight.

**Alternative Methods of Compliance (AMOCs)**

(g)(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

**Material Incorporated by Reference**

(h) You must use Boeing Service Bulletin DC10-28-243, dated February 22, 2005, to

perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for a copy of this service information. You may review copies at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW., Room PL-401, Nassif Building, Washington, DC; on the Internet at <http://dms.dot.gov>; or at the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on August 16, 2006.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E6-13985 Filed 8-24-06; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 97**

[Docket No. 30509; Amdt. No. 3181]

**Standard Instrument Approach Procedures; Miscellaneous Amendments**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment amends Standard Instrument Approach Procedures (SIAPs) for operations at certain airports. These regulatory actions are needed because of changes occurring in the National Airspace System, such as the commissioning of new navigational facilities, addition of new obstacles, or changes in air traffic requirements. These changes are designed to provide safe and efficient use of the navigable airspace and to promote safe flight operations under instrument flight rules at the affected airports.

**DATES:** This rule is effective August 25, 2006. The compliance date for each SIAP is specified in the amendatory provisions.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the **Federal Register** as of August 25, 2006.

**ADDRESSES:** Availability of matter incorporated by reference in the amendment is as follows:

*For Examination—*

1. FAA Rules Docket, FAA Headquarters Building, 800 Independence Ave., SW., Washington, DC 20591;

2. The FAA Regional Office of the region in which affected airport is located; or

3. The National Flight Procedures Office, 6500 South MacArthur Blvd., Oklahoma City, OK 73169 or,

4. The National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

*For Purchase—*Individual SIAP copies may be obtained from:

1. FAA Public Inquiry Center (APA-200), FAA Headquarters Building, 800 Independence Avenue, SW., Washington, DC 20591; or

2. The FAA Regional Office of the region in which the affected airport is located.

*By Subscription—*Copies of all SIAPs, mailed once every 2 weeks, are for sale by the Superintendent of Documents, US Government Printing Office, Washington, DC 20402.

**FOR FURTHER INFORMATION CONTACT:**

Donal P. Pate, Flight Procedure Standards Branch (AFS-420), Flight Technologies and Programs Division, Flight Standards Service, Federal Aviation Administration, Mike Monroney Aeronautical Center, 6500 South MacArthur Blvd., Oklahoma City, OK 73169 (Mail Address: P.O. Box 25082 Oklahoma City, OK 73125) telephone: (405) 954-4164.

**SUPPLEMENTARY INFORMATION:** This amendment to Title 14, Code of Federal Regulations, Part 97 (14 CFR part 97) amends Standard Instrument Approach Procedures (SIAPs). The complete regulatory description of each SIAP is contained in the appropriate FAA Form 8260, as modified by the National Flight Data Center (FDC)/Permanent Notice to Airmen (P-NOTAM), which is incorporated by reference in the amendment under 5 U.S.C. 552(a), 1 CFR part 51, and § 97.20 of the Code of Federal Regulations. Materials incorporated by reference are available for examination or purchase as stated above.

The large number of SIAPs, their complex nature, and the need for a special format make their verbatim publication in the **Federal Register**