

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2008-1324; Directorate Identifier 2008-NM-101-AD; Amendment 39-15875; AD 2009-08-02]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model DC-8-50 Series Airplanes; Model DC-8F-54 and DC-8F-55 Airplanes; Model DC-8-60 Series Airplanes; Model DC-8-60F Series Airplanes; Model DC-8-70 Series Airplanes; and Model DC-8-70F Series Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for all McDonnell Douglas airplanes identified above. This AD requires revising the airplane flight manual to provide the flightcrew with procedures to preclude dry running of the fuel pumps. This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent pump inlet friction (i.e., overheating or sparking) when the fuel pumps are continually run as the center wing fuel tank becomes empty, and/or electrical arc burnthrough, which could result in a fuel tank fire or explosion.

DATES: This AD is effective May 13, 2009.

ADDRESSES:

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (telephone 800-647-5527) is the Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: William Bond, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5253; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an airworthiness directive (AD) that would apply to all McDonnell Douglas Model DC-8-50 series airplanes; Model DC-8F-54 and DC-8F-55 airplanes; Model DC-8-60 series airplanes; Model DC-8-60F series airplanes; Model DC-8-70 series airplanes; and Model DC-8-70F series airplanes. That NPRM was published in the **Federal Register** on December 23, 2008 (73 FR 78678). That NPRM proposed to require revising the airplane flight manual to provide the flightcrew with procedures to preclude dry running of the fuel pumps.

Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed.

Costs of Compliance

We estimate that this AD will affect 156 airplanes of U.S. registry. We also estimate that it will take about 1 work-hour per product to comply with this AD. The average labor rate is \$80 per work-hour. Based on these figures, we estimate the cost of this AD to the U.S. operators to be \$12,480, or \$80 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979), and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

You can find our regulatory evaluation and the estimated costs of compliance in the AD Docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

2009-08-02 McDonnell Douglas:

Amendment 39-15875. Docket No. FAA-2008-1324; Directorate Identifier 2008-NM-101-AD.

Effective Date

- (a) This airworthiness directive (AD) is effective May 13, 2009.

Affected ADs

- (b) None.

Applicability

- (c) This AD applies to all McDonnell Douglas airplanes identified in Table 1 of this AD, certificated in any category.

TABLE 1—APPLICABILITY

Model
(1) DC-8-51, DC-8-52, DC-8-53, and DC-8-55 airplanes.
(2) DC-8F-54 and DC-8F-55 airplanes.

TABLE 1—APPLICABILITY—Continued

Model
(3) DC-8-61, DC-8-62, and DC-8-63 airplanes.
(4) DC-8-61F, DC-8-62F, and DC-8-63F airplanes.
(5) DC-8-71, DC-8-72, and DC-8-73 airplanes.
(6) DC-8-71F, DC-8-72F, and DC-8-73F airplanes.

Unsafe Condition

(d) This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent pump inlet friction (i.e., overheating or sparking) when the fuel pumps are continually run as the center wing fuel tank becomes empty, and/or electrical arc burnthrough, which could result in a fuel tank fire or explosion.

Compliance

(e) Comply with this AD within the compliance times specified, unless already done.

Airplane Flight Manual (AFM) Revision

(f) Within 14 days after the effective date of this AD, revise the Certificate Limitations Section of the Boeing DC-8 AFM to include the following procedures that preclude dry running of fuel pumps and/or electrical arc burnthrough (this may be done by inserting a copy of this AD into the AFM):

“During level flight, the applicable alternate or center wing auxiliary tank boost pump switch must be placed in the OFF position no more than 5 minutes after the auto fill light is continuously illuminated.

DO NOT reset any tripped fuel pump circuit breakers.”

Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: William Bond, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles ACO, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5253; fax (562) 627-5210.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Material Incorporated by Reference

(h) None.

Issued in Renton, Washington, on March 30, 2009.

Steve Boyd,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E9-7791 Filed 4-7-09; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2008-1129; Airspace Docket No. 08-ANM-7]

Establishment of Class E Airspace; Ten Sleep, WY

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action will establish Class E airspace at Ten Sleep, WY. Additional controlled airspace is necessary to accommodate aircraft using a new Area Navigation (RNAV) Global Positioning System (GPS) Standard Instrument Approach Procedure (SIAP) at Red Reflet Ranch Airport, Ten Sleep, WY. This will improve the safety of Instrument Flight Rules (IFR) aircraft executing the new RNAV GPS SIAP at Red Reflet Ranch Airport, Ten Sleep, WY.

DATES: *Effective Date:* 0901 UTC, July 2, 2009. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

FOR FURTHER INFORMATION CONTACT: Eldon Taylor, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue, SW., Renton, WA 98057; telephone (425) 203-4537.

SUPPLEMENTARY INFORMATION:**History**

On February 13, 2009, the FAA published in the **Federal Register** a notice of proposed rulemaking to establish controlled airspace at Ten Sleep, WY (74 FR 7204). Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.9S signed October 3, 2008, and effective October 31, 2008, which is incorporated by reference in 14 CFR part 71.1. The Class E airspace designations listed in this document will be published subsequently in that Order.

The Rule

This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 by establishing Class E airspace at Ten Sleep, WY. Controlled airspace is

necessary to accommodate IFR aircraft executing new RNAV (GPS) SIAPs at Red Reflet Ranch Airport, Ten Sleep, WY.

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this regulation: (1) Is not a “significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that will only affect air traffic procedures and air navigation, it is certified that this rule, when promulgated, will not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. The FAA’s authority to issue rules regarding aviation safety is found in Title 49 of the U.S. Code. Subtitle 1, Section 106 discusses the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency’s authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it establishes controlled airspace at Red Reflet Ranch Airport, Ten Sleep, WY.

List of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (air).

Adoption of the Amendment

■ In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR part 71 as follows:

PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

■ 1. The authority citation for 14 CFR part 71 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959–1963 Comp., p. 389.

§ 71.1 [Amended]

■ 2. The incorporation by reference in 14 CFR 71.1 of the Federal Aviation Administration Order 7400.9S, Airspace