

**(a) Comments Due Date**

We must receive comments by June 28, 2019.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Bombardier, Inc., Model DHC-8-400, -401, and -402 airplanes, certificated in any category, serial numbers 4001 through 4580 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight controls.

**(e) Reason**

This AD was prompted by reports of cracked elevator power control unit (PCU) brackets on the horizontal stabilizer rear spar and cracking on the elevator front spar. We are issuing this AD to address this condition, which, if not detected and corrected, may cause failure of an elevator PCU bracket or fracture the front spar into two segments; either structural failure may cause a jam in one elevator or a loss of airplane pitch control if both elevators are affected.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Inspections**

No earlier than 7,500 total accumulated flight hours, but before accumulating 8,000 flight hours after the effective date of this AD: Perform detailed visual and fluorescent penetrant inspections for cracks and damage of the elevator PCU brackets, horizontal stabilizer rear spar, and elevator front spar, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-55-09, dated June 7, 2018.

(1) If any crack is detected on any elevator PCU bracket, and no crack or damage is found on either spar: Before further flight, replace the elevator PCU bracket with a new bracket, and do all related investigative and corrective actions, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-55-09, dated June 7, 2018.

(2) If any crack or damage is detected on any horizontal stabilizer rear spar or elevator front spar: Before further flight, repair using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(h) Reporting**

At the applicable time specified in paragraph (h)(1) or (h)(2) of this AD: Report the results of the inspections required by paragraph (g) of this AD to the Bombardier CMDDB Focal by fax 1-416-375-4538 or email at [cmdb.requests@aero.bombardier.com](mailto:cmdb.requests@aero.bombardier.com), in accordance with the instructions of Bombardier Service Bulletin 84-55-09, dated June 7, 2018. If operators have reported findings as part of obtaining any corrective actions approved by Bombardier, Inc.'s TCCA

DAO, operators are not required to report those findings as specified in this paragraph.

(1) If the inspections were done on or after the effective date of this AD: Submit the report within 30 days after the inspections.

(2) If the inspections were done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or TCCA; or Bombardier, Inc.'s TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

(3) *Reporting Requirements*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW, Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2018-34, dated December 17, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0322.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, Airframe and Mechanical Systems Section,

FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7330; fax 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on May 2, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019-09807 Filed 5-13-19; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2019-0324; Product Identifier 2019-NM-031-AD]

**RIN 2120-AA64**

**Airworthiness Directives; Fokker Services B.V. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Fokker Services B.V. Model F28 Mark 0070 and 0100 airplanes. This proposed AD was prompted by reports of cracks on certain nose landing gear (NLG) turning tubes resulting from incorrectly applied repairs. This proposed AD would require removing the affected parts and replacing them with serviceable parts. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 28, 2019.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For Fokker service information identified in this NPRM, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); internet <http://www.myfokkerfleet.com>. For Safran service information identified in this NPRM, contact Safran Landing Systems, One Carbon Way, Walton, KY 41094; telephone (859) 525-8583; fax (859) 485-8827; internet <https://www.safran-landing-systems.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2019-0324; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (phone: 800-647-5527) is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3226.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to

an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2019-0324; Product Identifier 2019-NM-031-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2019-0037, dated February 19, 2019 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Fokker Services B.V. Model F28 Mark 0070 and 0100 airplanes. The MCAI states:

Occurrences have been reported of finding cracks on certain NLG turning tubes. The subsequent investigation results revealed that the cracks initiated from an area that is sensitive to fatigue cracking, which had been subject to incorrectly applied repairs.

This condition, if not detected and corrected, could lead to NLG turning tube failure, possibly resulting in damage to the aeroplane and injury to occupants.

To address this potential unsafe condition, Fokker Services published the SB [service bulletin] to provide replacement instructions, referring to SLS [Safran Landing Systems] SB F100-32-117 for in-shop inspection.

For the reasons described above, this [EASA] AD requires removal from service of the affected part and replacement with a serviceable part.

You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for

and locating Docket No. FAA-2019-0324.

#### Related Service Information Under 1 CFR Part 51

Fokker Services B.V. has issued Fokker Service Bulletin SBF100-32-171, dated November 27, 2018. This service information describes procedures for removing and replacing affected NLG turning tubes.

Safran has issued Service Bulletin F100-32-117, dated July 30, 2018. This service information describes procedures for a magnetic particle or eddy current inspection of NLG turning tubes.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA’s Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

#### Proposed Requirements of This NPRM

This proposed AD would require accomplishing the actions specified in the service information described previously.

#### Costs of Compliance

We estimate that this proposed AD affects 4 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
9 work-hours × \$85 per hour = \$765 .....	\$1,282	\$2,047	\$8,188

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in

air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Fokker Services B.V.:** Docket No. FAA–2019–0324; Product Identifier 2019–NM–031–AD.

#### (a) Comments Due Date

We must receive comments by June 28, 2019.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Fokker Services B.V. Model F28 Mark 0070 and 0100 airplanes, certificated in any category, all manufacturer serial numbers.

#### (d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

#### (e) Reason

This AD was prompted by reports of cracks on certain nose landing gear (NLG) turning tubes resulting from incorrectly applied repairs. We are issuing this AD to address cracking of NLG turning tubes, which could lead to NLG turning tube failure, possibly resulting in damage to the airplane and injury to occupants.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Definitions

(1) An affected part is an NLG turning tube assembly having part number (P/N) 201456200, 201071202, 201071240, or 201071241; installed on an NLG unit having a P/N identified in Safran Service Bulletin F100–32–117, dated July 30, 2018.

(2) A serviceable part is an affected part that is new or that, before installation, has passed an inspection (no cracks found, having the correct radius) in accordance with the Accomplishment Instructions of Safran Service Bulletin F100–32–117, dated July 30, 2018.

#### (h) Replacement

Within 22,000 flight cycles after the effective date of this AD: Replace the affected parts, with serviceable parts, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100–32–171, dated November 27, 2018.

#### (i) Parts Installation Limitation

As of the effective date of this AD, no person may install, on any airplane, an affected part, unless it is a serviceable part.

#### (j) No Reporting Requirement

Although Safran Service Bulletin F100–32–117, dated July 30, 2018, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

#### (k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (l)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Fokker Services B.V.'s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2019–0037, dated February 19, 2019, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2019–0324.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3226.

(3) For Fokker service information identified in this AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88–6280–350; fax +31 (0)88–6280–111; email [technicalservices@fokker.com](mailto:technicalservices@fokker.com); internet <http://www.myfokkerfleet.com>. For Safran service information identified in this AD, contact Safran Landing Systems, One Carbon Way, Walton, KY 41094; telephone (859) 525–8583; fax (859) 485–8827; internet <https://www.safran-landing-systems.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on May 3, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019–09644 Filed 5–13–19; 8:45 am]

**BILLING CODE 4910–13–P**